

Copy

21808 Iron

Cardiff, Bristol, Swansea, & Districts.

Lloyd's Register of British & Foreign Shipping.

ENGINEER'S DEPARTMENT.

J. Wood, Cardiff.

Cardiff, October 2<sup>nd</sup> 1878

S. S. "Ascupart"


This is to certify that the undersigned  
Lloyd's Engineer Surveyor held a survey at the request  
of the Owners on the Crank Shaft of S. S. "Ascupart"  
858 Register of Southampton for the purpose of ascertain-  
ing the nature of a flaw reported therein.

On proceeding to the vessel when lying in the  
Penarth Dock, made a careful examination of the  
Shaft and noted two longitudinal flaws in the after  
Crank pin, one of which was of a dangerous nature  
extending nearly the full length of the pin and running  
into the crank web, at a visible depth of half an  
inch.

In consequence of this flaw the undersigned  
recommended that the shaft be removed and replaced  
by a new one.

This also certifies that the undersigned examined  
the new shaft before & after it was fitted complete on  
board and found it in good condition and the Engines  
working in a satisfactory and efficient manner under  
the steam trial.

J. D. Chas. H. Jacobs

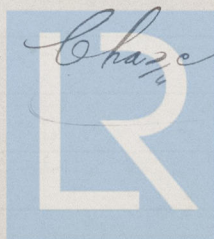

Lloyd's Register  
Foundation

Iron 480-0279