

9434

REPORT of SURVEY for REPAIRS.

Damage

No. 529 Survey held at London Date January 5th 19th 1843

on the Barque "Sudlow" Master

Tonnage 287 Built at Sunderland When built 1832

By whom built Owners Graham

Port belonging to London Destined Voyage Semurra

Surveyed ~~Afloat~~ or in Dry Dock Simkins dock

Original Survey, No. 632, Dated Classed 11 A 1

Port London 3583-5340-6003-7570-8090

REPAIRS At the present time

Shipped, hung, caulked from the keel to the main next the waterways, fitted new plankwork & then strake on the Starboard quarter & shifted 6 shal planks & shal of Counter timbers; shifted 2 shal planks on the larboard quarter New Quarter pieces on both sides - Repaired bulwarks Rails & Chain plates, new Main & Mizzen Mast, with yards Rigging, sails &c (which had been carried away) Sheathed with yellow metal on paper

Present Condition of the

Decks <u>in good condition</u>	Transoms <u>good when run</u>	Windlass <u>good</u>
Upper Deck Beams & Fastenings <u>very firm & good</u>	Timbers of the Frame <u>good</u>	Capstan <u>"</u>
Lower Deck Beams & Fastenings <u>good</u>	Topsides <u>good</u>	Pumps <u>"</u>
Spirkettling <u>good</u>	Wales <u>"</u>	Masts, Yards, &c. <u>part new</u>
Plank Shears <u>"</u>	Counter <u>"</u>	Sails <u>part new</u> } Main & Mizzen
Waterways <u>"</u>	Plank and Treencails (Outside to the Water's Edge) <u>"</u>	Cables <u>good & sufficient</u>
Hatchway Comings <u>"</u>	Rudder <u>"</u>	Anchors No. of <u>"</u>
Breasthooks <u>"</u>	Copper <u>yellow metal new</u>	Standing & Running Rigging <u>part new</u>

General Observations and Opinion, This Ship is in very good condition several September exposed all which are in a very sound state & well secured - In our Opinion she should remain as classed 11 A 1


W. G. Clarke

The Amount of Fee.....£ 1 : - : - is received by me, *W. G. Clarke*

Committee's Minute 7th February 1843

Character assigned 11 A 1

Special A 5-5-

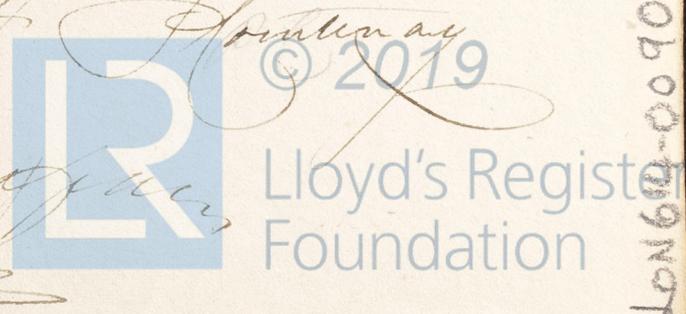

0600-0090