

# 11029 of Owners **REPORT of SURVEY for REPAIRS.** *Chang*

No. 21 Survey held at London Date 23 May 1843  
 on the Ship "York" Master \_\_\_\_\_  
 Tonnage 901 Built at New Brunswick When built 1839  
 By whom built \_\_\_\_\_ Owners Luscomb & Co  
 Port belonging to London Destined Voyage North America  
 Is Surveyed Afloat or in Dry Dock Wm. Curlew's Dock and afloat at  
the West India Quay

Original Survey, No. 8610 Dated \_\_\_\_\_ Classed L.R.

Port London

## REPAIRS

at this time she has had the Copper stripped off her bottom and grained but not recoppered. She has been opened on the Starboard side at the 2<sup>d</sup> futtock heads timbers all spruce & pine of very large scantling sided 12 & 13 inches and moulded 12 1/2 inches & perfectly sound. She shows no symptoms of working and is in my opinion a strong & sound ship.

## Present Condition of the

|                               |             |  |                    |                            |                       |
|-------------------------------|-------------|--|--------------------|----------------------------|-----------------------|
| Decks                         | <u>Good</u> | Transoms   | <u>Good</u>        | Windlass                   | <u>Good</u>           |
| Upper Deck Beams & Fastenings | <u>Good</u> | Timbers of the Frame                               | <u>When sunken</u> | Capstan                    | <u>Good</u>           |
| Lower Deck Beams & Fastenings | <u>Good</u> | Topsides   | <u>Good</u>        | Pumps                      | <u>Good</u>           |
| Spirketting                   | <u>Good</u> | Wales  | <u>Good</u>        | Masts, Yards, &c.          | <u>Sufficient new</u> |
| Plank Shears                  | <u>Good</u> | Counter  | <u>Good</u>        | Sails                      | <u>new</u>            |
| Waterways                     | <u>Good</u> | Plank & Treenails<br>(Outside to the Water's Edge) | <u>Good</u>        | Cables                     | <u>Sufficient</u>     |
| Hatchway Comings              | <u>Good</u> | Rudder   | <u>Good</u>        | Anchors No. of             | <u>20</u>             |
| Breasthooks                   | <u>fair</u> | Copper   | <u>taken off</u>   | Standing & Running Rigging | <u>20</u>             |

## General Observations and Opinion,

as she is in efficient Condition  
 she may remain as Clapped

*Joseph H. Ritchie*

The Amount of Fee.....£ 3 : - : - is received by me, W. H. 1844

Committee's Minute 4th October 1844

Character assigned AT 1




© 2019

Lloyd's Register  
 Foundation

LON 68-0040




They was not the rule, Section 63,  
fully complied with -

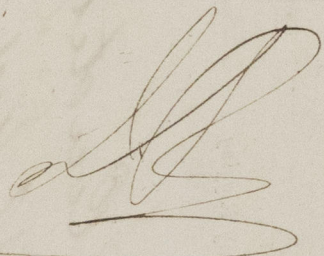W. Lister 

at the time she was buried  
she had 7 months to live  
on ~~A~~ Clap - and did  
not require of course  
to be opened -

C. H. H. H.

5 Oct 1844

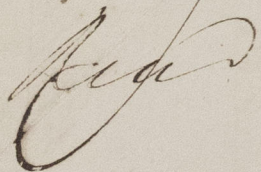



© 2019

Lloyd's Register  
Foundation