

# REPORT of SURVEY for REPAIRS.

*& Change of Crew*

12428

No. *393* Survey held at *Sidon* Date *March 20<sup>th</sup>* 18*86*  
 on the *Bk John Calvin* Master *R. Hunter*  
 Tonnage *420* Built at *Greenock* When built *1839*  
 By whom built *Do* Owners *R. Hunter*  
 Port belonging to *Sidon* Destined Voyage *Proflta To Land, Persia*  
 If Surveyed Afloat or in Dry Dock *Wigram's Dock*

Last Survey, No. \_\_\_\_\_ Classed *10 A1*


Port of *Sidon*

REPAIRS *six pairs of iron hanging knees to the upper deck beams & two to the  
 side beams, caulked from the upper ironale, opened fire & upper beam &  
 below the side beams in ground in a sound state*

## Present Condition of the

Decks <i>good</i>	Trenails <i>good</i>	Windlass and Capstan <i>good</i>
Wayways <i>good</i>	Breasthooks and Stelson <i>good</i>	Pumps <i>good</i>
Comings <i>good</i>	Transoms, Pointers, and Crutches <i>good</i>	Bowls <i>three</i>
Upper Deck Beams & Fastenings <i>good</i>	Timbers of the Frame <i>good</i>	Masts, Yards, &c. <i>good</i>
Lower Deck Beams & Fastenings <i>good</i>	Keelsons <i>good</i>	Sails <i>well found</i>
Planksheers <i>good</i>	Clomps and Shells <i>good</i>	Anchors No. of 3 <i>Breaks 4 Stm 2 Bidge</i>
Sheerstrakes <i>good</i>	Ceiling <i>good</i>	Cables <i>well found</i>
Topside <i>good</i>	Rudder <i>good</i>	Hawsers and Warps <i>good</i>
Wales <i>good</i>	Copper <i>good</i>	Standing & Running Rigging <i>good</i>
Plank (Bottom) and Counter <i>good</i>		

General Observations and Opinion *From her general efficient condition I am of opinion she  
 may retain her present class*

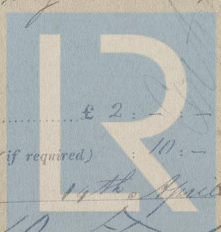

© 2019

The Amount of Fee *£ 2* is received by me. *H*

Certificate (if required) *10*

Committee's Minute *14th March 1886*

Character assigned *10*

Lloyd's Register  
 Foundation

LON 620-0464