

# REPORT of SURVEY for REPAIRS.

15748

No. 829 on the B<sup>th</sup> Cumberland Survey held at London Date May 4<sup>th</sup> 1849  
 Tonnage 290 Built at Whitehaven Master J Harrison When built 1835  
 By whom built \_\_\_\_\_ Owners J A Carr  
 Port belonging to London Destined Voyage \_\_\_\_\_  
 If Surveyed Afloat or in Dry Dock In Fair & aft Dry Dock

Dec 10 May

Specially Surveyed in 1848

Last Survey, No. 12962 Port London Classed 9 \*A. 1  
C 13 1 mo 40

REPAIRS at the present time of damages sustained by striking the ground while lying at anchor outside Odessa Mole also by stress of weather in her homeward passage between Odessa and Malta, more particulars in Special Report. One new Pintle to Rudder and the rest of the Hangings secured. Ship hung in Shores, Caulked at Keel Seam Head ends and from lower edge of Wales upwards to second seam of Deck next the Waterway;

Not of accident. The Copper Sheathing stripped off Bottom Caulked and Sheathed with Yellow Metal upon

LON 626-0346

## Present Condition of the

Decks	Treenails	Windlass and Capstan
Waterways } <u>good</u>	Breasthooks and Stenson } <u>good &amp; true seen</u>	Pumps
Comings	Transoms, Pointers, and Catches	Boats
Upper Deck Beams & Fastenings	Timbers of the Frame	Masts, Yards, &c. <u>In good order</u>
Lower Deck Beams & Fastenings } <u>disblue seen</u>	Keelsons <u>d<sup>o</sup></u>	Sails <u>and sufficient</u>
Planksheers	Clamps and Shelves <u>d<sup>o</sup></u>	Anchors No. of
Sheerstrakes <u>d<sup>o</sup></u>	Ceiling <u>d<sup>o</sup></u>	Cables
Topsides <u>d<sup>o</sup></u>	Rudder <u>d<sup>o</sup></u>	Hawsers and Warps
Wales <u>d<sup>o</sup></u>	Copper <u>Yellow Metal</u> When put on <u>now new</u>	Standing & Running Rigging
Plank (Bottom) and Counter <u>d<sup>o</sup></u>		

## General Observations and Opinion,

This Barque is now in good condition fit for the safe conveyance of dry and perishable cargoes to and from all parts of the world eligible to remain as classed \*A. 1

The Amount of Fee.....£ ✓ : \_\_\_\_\_ is received by me,


Special..... 3 : 3 : -

Certificate (if required) \_\_\_\_\_

Committee's Minute 15<sup>th</sup> May 1849

Character assigned See Report

Special Report L & L  
 on Damage

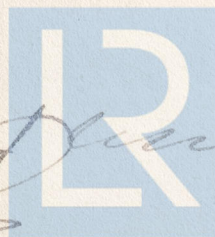

© 2019

Lloyd's Register  
 Foundation