

REPORT of SURVEY for REPAIRS.

Continuation

No. 238 on the *Brig "James"* Survey held at *Sondou* Date *19 Dec 1850*
 Master *Mainland*
 Tonnage *252* Built at *Sunderland* When built *1840*
 By whom built _____ Owners *C Walton*
 Port belonging to *Sondou* Destined Voyage _____
 If Surveyed Afloat or in Dry Dock *in Carters Dock*

Last Survey, No. *15908* Port *Sondou* Classed *g E.A.*

REPAIRS

at present wales topsides and sheerstrakes
 scraped bright - all the upper sheerstrakes
 plank sheers and waterways removed on both
 sides except the fore hoods or fore lengths round
 the bows - 39 new short top timbers and 15
 filling timbers fitted on the Starboard side and
 8 new longtree stanchions - and 34 new top timbers
 and 14 filling timbers + 7 new longtrees fitted
 on the Starboard side all of English oak -
 3 new half beams 1 ditto clamped 2 new wood bedging
 knees and 30 new chocks to the wood knees -
 5 pairs of iron standard knees fitted on the hold
 & lower

Present Condition of the

Decks	Good	Treenails	Good	Windlass and Capstan	
Waterways	New	Breasthooks and Stemson		Pumps	
Comings	Good	Transoms, Pointers, and Crutches		Boats	
all in boat bolts new		Many new above		Masts, Yards, &c.	Good
Upper Deck Beams & Fastenings	5 pairs iron stanchions	Timbers of the Frame		Sails	and
Lower Deck Beams & Fastenings	New fitted	Keelsons		Anchors No. of	Sufficient
Plank sheers		Clamps and Shelves		Cables	
Sheerstrakes	Scraped	Ceiling		Hawsers and Warps	
Topsides	bright	Rudder		Standing & Running Rigging	
Wales	good	Copper	Ym When put on 1849		
Plank (Bottom) and Counter					

General Observations and Opinion,

This vessel is in efficient Condition
 and in our opinion fit to be Continued
 on the first class Reg from 1849. 37.5.1.1

The Amount of Fee.....£ 3 : - : - is received by me,

Special..... 3 : 3 : -


Certificate (if required) : :

Committee's Minute *24 Dec 1850*

Character assigned

W.P.A. 1 yr 3 yrs

1849 - used upon

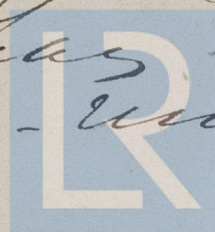

© 2019
 Lloyd's Register
 Foundation
 LON 629 - 0350

16492 Jan.

beams new waterways of red pine new sheer
strakes of East India Oak Plank sheers English
Oak - Port New Lough trees Nail and all new Plank
Cabin windows filled in & boarded over - Channel
bindings all rebolted three breast hooks rebolted
Caulked from the yellow metal up including Port
& upper deck - The upper deck & covering the upper
and lower deck bolts and the planks thro which
they pass the main timbers Rings heads breast
hooks and transoms the floors & Keelson the
planking outside & ceiling the frame & inner
surface of the outside planking where seen
are sound & good and the sheer and general
form unaltered -

J. H. Ritchie
" "
J. Courtney



© 2019

Lloyd's Register
Foundation