

REPORT of SURVEY for REPAIRS.

and Continuation

No. 53 Survey held at London Date 3rd to 12th May 1858
 on the Ship "Barham" Master Parish
 Tonnage 1149 Built at London When built 1846
 By whom built _____ Owners R. Green
 Port belonging to London Destined Voyage _____
 If Surveyed Afloat or in Dry Dock Messrs. Green's Dry Dock

Last Survey, No. 21152 Port London Classed 12 A 1.

REPAIRS now done :- in accordance with the Rules Section (54).
 The vessel scraped bright from the light water mark upwards
 including the planksheers and waterways. bolts and trenails,
 driven out for survey and found in good condition.

Repairs done viz :- Yellow metal sheathing stripped off.
 Ship hung in shores and caulked from the keel upwards to the
 waterway seam. Yellow metal renewed upon paper.

Long transom renewed of Oak, and the next piece
 on the Starboard side. Three after hoods of wales renewed on
 the Port side and two on the Starboard side, of E. Oak.
 Iron transoms knee refitted and bolted, all the ceiling in the
 flat of floor taken up and refitted, the timbers in way of the
 same found in good condition.

Decks	Trenails	Windlass and Capstan
Waterways	Breasthooks and Stemson	Pumps
Comings	Transoms, Pointers, and Crutches	Boats
Upper Deck Beams & Fastenings	Timbers of the Frame	Masts, Yards, &c.
Lower Deck Beams & Fastenings	Keelsons	Sails
Planksheers	Clamps and Shelves	Anchors No. of
Sheerstrakes	Ceiling	Cables
Topsides	Rudder	Hawsers and Warps
Wales	Copper <u>Y. M.</u> When put on <u>new</u>	Standing & Running Rigging
Plank (Bottom) and Counter	<u>upon paper</u>	

General Observations and Opinion,

Caulking of Bottom, Deck, & Waterways. good where tried

This vessel having undergone the whole of the
 requirements of the Rule Section (54) and being in good
 condition, the are of opinion she is eligible to be Continued for
 a period as allowed by the Rules A 1. for 4 years from 1858


The Amount of Fee.....£ 8 : : is received by me,

Special..... 3 : 3 : -

Certificate (if required) : 5 : -

Committee's Minute 18th June 1858

Character assigned Cont 1 for 4 years

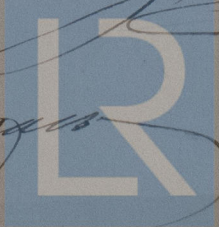

Lloyd's Register
 Foundation

21815 Lon.

" The upper or main deck and coverings,
The upper and lower deck bolts, and the outside planks
through which they pass, the plank sheers, waterways,
and beams, so far as they can be examined; The house-
timbers, knightheads, breasthooks, and transoms,
the floors and keelsons; The keel and rudder, the
planking outside, and the treenails passing through
from the light water-mark upwards; The ceiling inside,
and the frame and inner surface of the outside planking
where it can be seen appears in good condition. "

H. J. Bolles.
J. D. Martin



© 2019

Lloyd's Register
Foundation