

24884

REPORT of SURVEY for REPAIRS.

No. 211 Survey held at London Date August 12th 18 62
on the Bth Helen Master J Richards
Tonnage 289 Built at Newport When built 1839
By whom built _____ Owners Cook & Co
Port belonging to Bristol Destined Voyage West Indies
If Surveyed Afloat or in Dry Dock New Crane dry dock

Last Survey, No. 211376 Port London Classed 12 A 1
Ret 56 — 8 62

REPAIRS

Now done; on port side six third futtocks, two second and nine
chocks and on starboard side six third six second and ten
chocks renewed with English Oak, one piece of lower deck shelf
on the port side and the midship shifts of ceiling on both sides
from lower deck clamp to bilges renewed with English Oak —
The caulking from keel to plank sheers and the Yellow Metal renewed
on Felt

Present Condition of the

Decks		Treenails		Windlass and Capstan	
Waterways		Breasthooks and Stemson		Pumps	
Comings		Transoms, Pointers, and Crutches		Boats	
Upper Deck Beams & Fastenings		Timbers of the Frame		Masts, Yards, &c.	
Lower Deck Beams & Fastenings		Keelsons		Sails	
Plank sheers		Clamps and Shelves		Anchors No. of	
Sheerstrakes		Ceiling		Cables	
Topsides		Rudder		Hawsers and Warps	
Wales		Copper <u>E & M</u> When put on <u>new</u>		Standing & Running Rigging	
Plank (Bottom) and Counter					

General Observations and Opinion,

Caulking of Bottom, Deck, & Waterways.

good where tested

This vessel is now in good condition and is eligible
in our opinion to remain classed A 1


The Amount of Fee.....£ : 10:— is received by me,

Special..... 3: 3:—

Certificate (if required) : :—

Committee's Minute 9th September 18 62

Character assigned Good

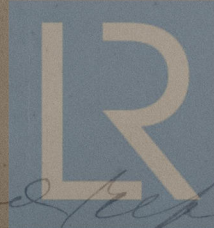

© 2019

Lloyd's Register
Foundation

100646-0075