

COPY.

Lloyd's Register of Shipping.

Port

PHILADELPHIA, PA.
6th November, 1940


This is to Certify that

D. HANBETH

the undersigned Surveyor to this Society did at the request of the Brazilian Consul at Philadelphia, attend the Tanker "J.E. O'NEIL", official No. 215903, while lying on drydock at the Sun Shipbuilding & Dry Dock Company, Chester, Pa., November 1, 1940, and have to report as follows:-

- 1) The vessel's bottom, stem, stern frame, rudder bushings, propeller and outside shell plating were examined and found in good order. The bottom was recoated.
- 2) The Stern Bushing wear down was 5/32".
- 3) The sea valves were opened out, overhauled, examined and found satisfactory.
- 4) Small leaks in forepeak tank, port and starboard sides were caulked and made tight.
- 5) The docking plug in No. 1 Tank was tightened. Two small cracks in rudder arms were veed-out and welded.

This vessel is now, in my opinion, in good and efficient condition, eligible to remain as classed in Lloyd's Register of Shipping (+100A1), and fit to carry petroleum in bulk.

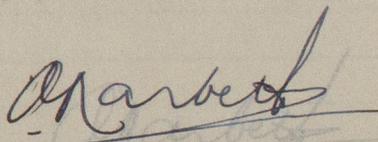

Surveyor to Lloyd's Register
of Shipping

© 2020

This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:-

"While the Committees of the Society use their best endeavours to ensure that the functions of the Society are properly executed, it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances whatever to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other publication of the Society, or for any error of judgment, default or negligence of any of its Committees or any Member thereof, or the Surveyors, or other Officers or Agents of the Society."