

For the information of Surveyors and the Committee only.

Received at _____ Office _____ 19

Lloyd's Register of Shipping.

Order: 15878/St
Post: 112/7

(Report on Vessel No. _____ Port _____)

No. 3177 SHIP ~~FORGINGS OR~~ CASTINGS.

I have to report that the undermentioned ~~Iron or Steel Forgings or~~ Castings, manufactured by Messrs. Witkowitz Bergbau & Eisenh. Gew. of Witkowitz for the Vessel No. 45, being built by Messrs. Odense Staalskibsvaerft of Odense have been inspected by me as set forth below and found to be, so far as can be seen, 1 stern frame top part, 1 stem frame keel piece, sound and free from defects.

It is on ~~Forgings or~~ Castings.

Lloyd's
No. 4523
HK.4.9.31

11158/59

Vienna, 14th September 1931

Hans Kolbow


	1 STERN FRAME. top part	1 stem RODDER FRAME. keel piece	STEM.
Material* ...	Siemens Martin Steel		
made ...	cast	cast	
annealed ...	annealed		
Dimensions ...	to sketch	to sketch	
Progress on Inspection ...	almost finished	almost finished	
Inspected when Inspected	13.8; 4.9.1931		
CASTINGS.	No: 11158	No: 11159	
Tests on Standard Test Pieces.			
Tensile Test—			
Tons per square inch ...	30.6 30.2	29.3 29.7	
Extension per cent. ...	34.2 32.8	34.2 35.5	
Bending Test—			
Angle before fracture ...	120 degrees	good	
Height Test—			
Height from ground ...	7'	8'	
Tempering Test—			
made according to Rules and found satisfactory ...	satisfactory	satisfactory	

SKETCHES OF FRAMES SHOWING POSITION AND DESCRIPTION OF WELDS OF FORGINGS.

Fee (if any chargeable) £ : :

To be paid at VIENNA

If of Iron, state whether scrap or puddled Iron. If of Steel, state whether made on the Open Hearth process.

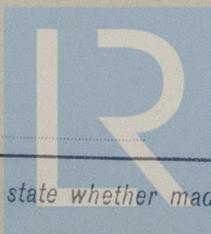

© 2019

Lloyd's Register Foundation

W208-0106