

REPORT ON ELECTRIC LIGHTING INSTALLATION. No. 1753

Port of Montreal Date of First Survey Sept. 29 Date of Last Survey Nov 6 No. of Visits 9
 No. in Reg. Book on the ~~Iron or Steel~~ S. S. "ALSACE" Port belonging to Dunkirk
 Built at Montreal By whom Canadian Vickers Ltd. When built 1919
 Owners la Francaise Armeement & Impatriation de l'Etat Owners' Address Paris France When fitted 1919
 Yard No. 76 Electric Light Installation fitted by Builders

DESCRIPTION OF DYNAMO, ENGINE, ETC.

1- 11 KW Vickers dynamo direct coupled to a single cylinder (7x4) enclosed forced lubrication engine.

Capacity of Dynamo 90 Amperes at 125 Volts, whether continuous or alternating current Continuous.
 Where is Dynamo fixed Engine Room bottom platform Whether single or double wire system is used double
 Position of Main Switch Board " " " having switches to groups A-B-C-D-E of lights, &c., as below
 Positions of auxiliary switch boards and numbers of switches on each Distribution boxes and on each circuit.

If fuses are fitted on main switch board to the cables of main circuit Yes and on each auxiliary switch board to the cables of auxiliary circuits Yes and at each position where a cable is branched or reduced in size Yes and to each lamp circuit Yes

If vessel is wired on the double wire system are fuses fitted to both flow and return wires or cables of all circuits including lamp circuits Yes
 Are the fuses of non-oxidizable metal Yes and constructed to fuse at an excess of 80-100 per cent over the normal current

Are all fuses fitted in easily accessible positions Yes Are the fuses of standard dimensions Yes "N.E.C." If wire fuses are used are permanent instructions fitted on or near each switch board giving particulars of proper size of fuse for each circuit Cartridge fuses and

Are all switches and fuses constructed of incombustible materials and fitted on incombustible bases Yes

Total number of lights provided for 190 arranged in the following groups :-

A Fore Accom	64	lights each of	1-16cp. 4-15W. 12-25W. 46-40W.	candle power requiring a total current of	18.7	Amperes.
B Aft Accom	24	lights each of	2-2 1/2 cp. 11-25W. 11-40W.	candle power requiring a total current of	5.6	Amperes
C Navigating	23	lights each of	9-2 1/2 cp. 4-16cp. 1-32cp. 6-8cp. 3-40W.	candle power requiring a total current of	6.2	Amperes
D E & Brown	39	lights each of	5-16cp. 34-40W.	candle power requiring a total current of	12.8	Amperes
E Large quadrants	44	lights each of	32.	candle power requiring a total current of	39.5	Amperes
2 Mast head light with	1	lamps each of	16	candle power requiring a total current of	1.0	Amperes
2 Side light with	1	lamps each of	16cp. 32cp. 5	candle power requiring a total current of	1.4	Amperes
5 Cargo lights of		<u>Spacelights</u>	32	candle power, whether incandescent or arc lights	<u>Incandescent</u>	

If arc lights, what protection is provided against fire, sparks, &c.

Where are the switches controlling the masthead and side lights placed In wheelhouse on navigating table.

DESCRIPTION OF CABLES.

Main cable carrying	116	Amperes, comprised of	19	wires, each	.084" ⁰⁰ S.W.G. diameter, .104 square inches total sectional area
Branch cables carrying	34	Amperes, comprised of	7	wires, each	.0613" ⁰⁰ S.W.G. diameter, .02 square inches total sectional area
Branch cables carrying	34	Amperes, comprised of	7	wires, each	.078" ⁰⁰ S.W.G. diameter, .0129 square inches total sectional area
Leads to lamps carrying	5	Amperes, comprised of	7	wires, each	.024" ¹⁴ S.W.G. diameter, .0032 square inches total sectional area
Cargo light cables carrying	5.4	Amperes, comprised of	27	wires, each	.01" ¹⁵ S.W.G. diameter, .002 square inches total sectional area

DESCRIPTION OF INSULATION, PROTECTION, ETC.


Rubber insulated, lead covered and armoured.

Joints in cables, how made, insulated, and protected No joints all connections made in W.T. Junction boxes.

Are all the joints of cables thoroughly soldered, and the flux used not containing acids or other corrosive substances Are all joints in accessible positions, none being made in bunkers, cargo spaces, or spaces which may at any time be used for carrying cargo, stores, or baggage

Are there any joints in or branches from the cable leading from dynamo to main switch board No.

How are the cables led through the ship, and how protected Clipped to decks & bulkheads with double conduit pipe. Steel stud guides & casing where run through bunker space in bridge.

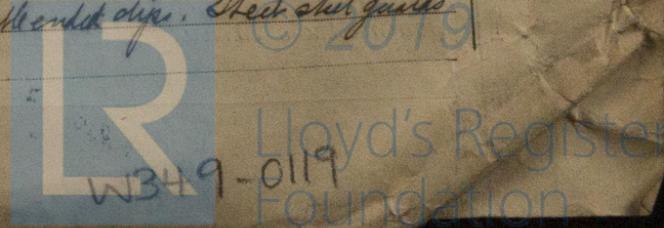

DESCRIPTION OF INSULATION, PROTECTION, ETC.—continued.

Are they in places always accessible *Yes excepting for short run through cargo space and in timber in bridge*
 What special protection has been provided for the cables in open alleyways or where exposed to weather or moisture *Lead covered & armoured*

What special protection has been provided for the cables near galleys or oil lamps or other sources of heat *ditto.*

What special protection has been provided for the cables near boiler casings *ditto*

What special protection has been provided for the cables in engine room *ditto.*

How are cables carried through beams *In lead bushings* through bulkheads, &c. *W. T. glands*

How are cables carried through decks *W.T. deck tubes.*

Are any cables run through coal bunkers *No* or cargo spaces *yes* or spaces which may be used for carrying cargo, stores, or baggage *yes*

If so, how are they protected *Steel steel guard casing & conduit.*

Are any lamps fitted in coal bunkers or spaces which may at times be used for cargo, coals, or baggage *yes*

If so, how are the lamp fittings and cable terminals specially protected *Lamps in heavy cast fittings. Cable in conduit.*

Where are the main switches and fuses for these lights fitted *On main switch board.*

If in the spaces, how are they specially protected *—*

Are any switches or fuses fitted in bunkers *No.*

Cargo light cables, whether portable or permanently fixed *Permanent to W.T. switch* How fixed *How fixed and flexible to motor.*

In vessels fitted on the single wire system, how is the dynamo terminal fixed to the hull of vessel

How are the returns from the lamps connected to the hull

Are all the joints with the hull in accessible positions

Is the installation supplied with a voltmeter *yes*, and with an amperemeter *yes*, fixed *On main switchboard*

VESSELS BUILT FOR CARRYING PETROLEUM.

In vessels built for carrying petroleum, are all switches and fuses fitted in positions not liable to the accumulation of petroleum vapour or gas

Are any switches, fuses, or joints of cables fitted in the pump room or companion

How are the lamps specially protected in places liable to the accumulation of vapour or gas

The copper used is guaranteed to have a conductivity of not less than that of the Engineering Standards Committee's standard, and the wires are protected by tinning from the sulphur compounds present in the insulating material.

Insulation of cables is guaranteed to have a resistance of not less than 1500 megohms per statute mile at 60° Fahrenheit after 24 hours' immersion in water, the test being made after one minute's electrification at not less than 500 volts and while the cable is still immersed.

The foregoing statements are a correct description of the Electric Light installation fitted by us on this vessel and we declare that it is at this date in good order and safe working condition.

M. Miller Electrical Engineers Date

COMPASSES.

Distance between dynamo or electric motors and standard compass *90 feet*

Distance between dynamo or electric motors and steering compass *98 feet*

The nearest cables to the compasses are as follows:—

A cable carrying	6.2 Amperes	8 feet from standard compass	8 feet from steering compass
A cable carrying	Amperes	feet from standard compass	feet from steering compass
A cable carrying	Amperes	feet from standard compass	feet from steering compass

Have the compasses been adjusted with and without the electric installation at work at full power

The maximum deviation due to electric currents, etc., was found to be _____ degrees on _____ course in the case of the standard compass and _____ degrees on _____ course in the case of the steering compass.

M. Miller Builder's Signature. Date

GENERAL REMARKS.

This installation has been fitted on board the vessel. The material and workmanship are good. It has been tried under steam at varying loads and found to be working satisfactorily.

It is submitted that this vessel is eligible for THE RECORD. ELEC. LIGHT. 9/2/19.

H. J. Alderson
Surveyor to Lloyd's Register of Shipping.

Committee's Minute

FRI. 12 DEC. 1919

THE SURVEYORS ARE REQUESTED NOT TO WRITE ACROSS THIS MARGIN.

Im. 11, 12.—Transfer.

