

Copy for the Copenhagen Office.

Received at

Office.

10

## Lloyd's Register of Shipping.

(Report on Vessel No. 548

Port

Copenhagen.)

No. 6182.


SHIP ~~FORGINGS OR~~ CASTINGS.

I have to report that the undermentioned ~~XXXXXX~~ Steel ~~XXXXXX~~ Castings, manufactured by the Kohlsua Steel Works, of Kolsva, Sweden, for the Vessel No. , being built by Messrs. Burmeister & Wain, of Copenhagen, have been inspected by me as set forth below and found to be, so far as can be seen, good, sound and free from defects.

Stockholm the 7th December 1927.

Mark on Forgings or Castings.

Lloyd's  
No. 6182  
AI 6.12.27. A

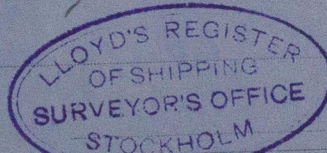

	STERN FRAME.	RUDDER FRAME.	STEM
Material*	S. M. Steel		
How made †	Cast and Annealed		
Dimensions	As per plan B-1		
Progress on Inspection	Cast and annealed		
Date when Inspected	6.12. 1927		
CASTINGS.			
Tests on Standard Test Pieces.			
Tensile Test— 8. XX Tons per square inch.	47,4 32,8		
Extension per cent.			
Cold Bending Test— Angle before fracture	120° R = 1"		
Drop Test— Height from ground ...	8 feet		
Hammering Test— If made according to Rules and found satisfactory ...	As per Rules, satisfactory.		

SKETCHES OF FRAMES SHOWING POSITION AND DESCRIPTION OF WELDS OF FORGINGS.

9 testholes have been drilled in the casting.

A. Hakson

X Per Bornman

Antagonist of date No.

Fee (if any chargeable) £

To be paid at

\* If of Iron, state whether scrap or puddled Iron. If of Steel, state whether made on the Open Hearth process.