

Rpt. 6.

For the information of Surveyors and the Committee only.

Received at

Office

19

Lloyd's Register of Shipping.

Korn No 764899-79-80

Order No 5069/362 Report on Vessel No. Port

No. 338

SHIP ~~FORGINGS~~ OR CASTINGS.

I have to report that the undermentioned ~~Iron or Steel Forgings or~~
 Castings, manufactured by Messrs. Skoda Works Ltd.
 of Pilsen, Bohemia for the Vessel No. 362, being built
 by Messrs. Aktiebolaget V B of Götawerken, Göteborg.
 have been inspected by me as set forth below and found to be, so far as can
 be seen, sound and free from defects

- 1 S. M. Steel Cast Stern frame (in two parts)
- 2 Propeller brackets & 2 Propeller bosses.

Mark on Forgings or Castings.

Lloyd's

No. 187-188

CRH 9-23

Prague 24th September 1923

C. H. Hughes

	STERN FRAME.	Propeller Brackets	Propeller bosses
Material*	Annnealed S. M. S. Steel		
How made	cast	cast	cast
Dimensions	450/300/50		
Progress on Inspection	Finished condition	Finished (part)	Rough machined
Date when Inspected	13. 9. 1923	13. 9. 1923	13. 9. 1923
CASTINGS.	Upper No 187 Lower	Port No 188 Starbd	Port No 179 Starbd.
Tests on Standard Test Pieces.			
Tensile Test—	50.6-50.3:52.2-52.8	49.7-50.3:49.3-49.7	52.5 52.2
Ext Tens per square inch	33.3-27.6:29.0-21.1	27.6-27.6:30.3-31.6	30.3 26.3
Extension per cent. ...			
Cold Bending Test—	120° satisfactory	120° satisfactory	120° Good
Angle before fracture			
Drop Test—	7 feet	7 feet	7 feet
Height from ground ...			
Hammering Test—	Yes, satisfactory	Yes, satisfactory	Yes, Satisfactory
If made according to Rules and found satisfactory ...			


SKETCHES OF FRAMES SHOWING POSITION AND DESCRIPTION OF WELDS OF FORGINGS.

Fee (if any chargeable) £

To be paid at

Prague

* If of Iron, state whether scrap or puddled Iron. If of Steel, state whether made on the Open Hearth process.

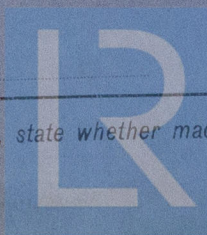

© 2019

Lloyd's Register
 Foundation

W434-0129

W434-0131